

Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 1 of 6

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **31KK1** Node: **015** Status: **Found**

Insp Date: **2/26/07 1:21 PM**

Incomplete Comments

Crew: **WM, JC**
Inspector: **Morris, W**
Firm: **RKK**

Location Address: **4338 CHARLES ST**

Cross Street: **OVERHILL RD**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Snow**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **21** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **60** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps

Count: **9** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 2 of 6

Location View



Location View



Top View



Adjustment infiltration. Corroded steps.
Bench debris.

Top View



Defect



Defect



Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 3 of 6

10 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **15.22** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Pipe In @ 4 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 4 of 6

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown**

☐ Pipe Lined

Invert Depth: **15.20** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease


Silt Depth: (in.)

Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Cracked**

Pipe In @ 6 O'Clock

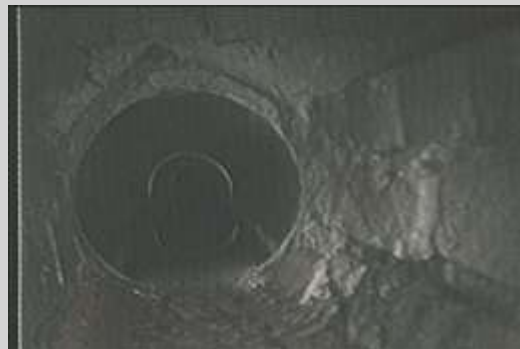

Channel deterioration.

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 5 of 6

10 in. Circular Gravity Sewer


Pipe In @ 7 O'Clock



Pipe In @ 7 O'Clock



Drop In @ 7 O'Clock

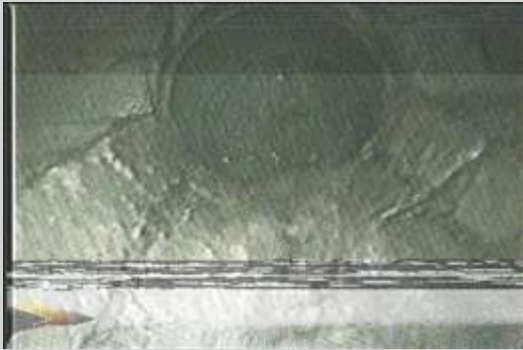

Rod and Bar (Angled)

Pipe Material: **Unknown**

☐ Pipe Lined

Invert Depth: **10.61** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Cracked**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **14.17** (ft.)

Inv Depth: **15.17** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S31KK1015MH

Printed On: 12/17/2008

Page 6 of 6

6 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Drop In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **10.30** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **14.15** (ft.)

Inv Depth: **15.15** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection